

ZD0858



JK202SPD


User instructions




Surge Protection Kit JK 250A Type II

Parts list:


1. 16mm sq neutral cable
2. 16mm sq L1/L2/L3 cable
3. 1 x M5 Hex Carp Nut
4. 16mm Earth Link cable
5. 1 x Type II SPD

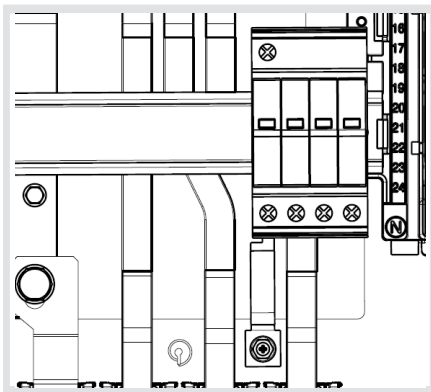

Clip surge protection device to din rail on the right hand side as shown & connect the copper earth link into the SPD and using the Hex head High Torque screw to the chassis at 5Nm
'Always install the chosen Incomer first'.


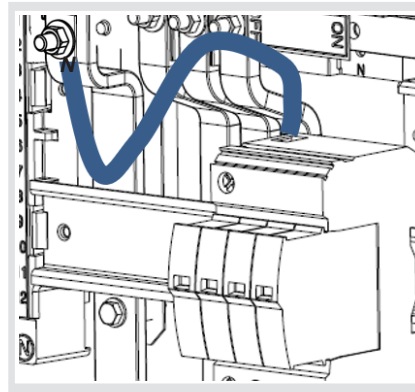


Connect Neutral cable to the neutral bar with the M5 hex Carp nut and torque to 5Nm

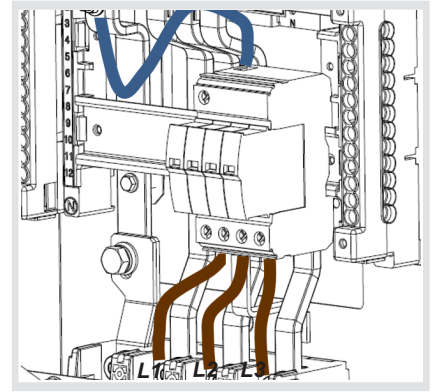

Connect the L1/L2/L3 cable lugs to the Incomer using the M8 Bolts provided making sure to use the flat washer and shake proof washer, torque to 13Nm

Torque all cable & earth connections into the surge protection device to 4.5Nm

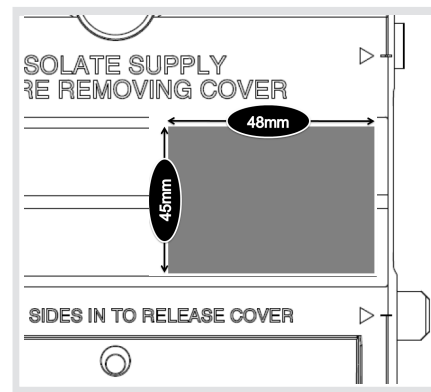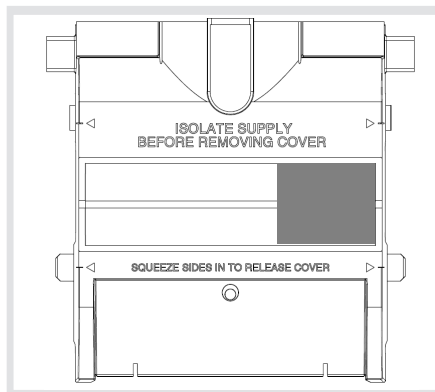

Mark the shroud ready for cutting out the aperture to allow the device to protrude through.

The device may only be connected and installed by an electrically skilled person. National standards and safety regulations must be observed.

The device must be checked for external damage prior to installation. If any damage or other defects are detected in this check, the device must not be installed.

Its use is only permitted within the limits shown and stated in the installation instructions.

Opening or otherwise tampering with the device invalidates the warranty.

ZD0858